



International Journal of  
**Architecture,  
Engineering and  
Construction**



September 2017 • Volume 6 Number 3  
ISSN 1911-110X (Print) ISSN 1911-1118 (Online)

**Editor-in-Chief**

Xueqing Zhang, PhD  
*Hong Kong University of Science and  
Technology, HKSAR, China*

**Honorary Editor**

Hojjat Adeli, PhD  
*Ohio State University, United States of America*

**Editor for Architecture**

Ewelina Woźniak-Szpakiewicz, PhD  
*Cracow University of Technology, Poland*

**Editor for Engineering**

Shunbo Zhao, PhD  
*North China University of Water  
Resources and Electric Power, China*

**Editor for Construction**

Onishi Masamitsu, PhD  
*Kyoto University, Japan*

**Editor for Management**

Shuibo Zhang, PhD  
*Tianjin University, China*

**Managing Editor**

Emad Elwakil, PhD  
*Purdue University, United States of America*  
Catherine C. X. Wang  
*International Association for Sustainable  
Development and Management, Canada*

# International Journal of Architecture, Engineering and Construction

**Editorial Advisory Board**

Simaan M. AbouRizk, PhD  
*University of Alberta, Canada*  
Bryan T. Adey, PhD  
*ETH Zurich, Switzerland*  
Thomas Bock, PhD  
*Technical University of Munich, Germany*  
Dongping Fang, PhD  
*Tsinghua University, China*  
Makarand Hastak, PhD  
*Purdue University, United States of America*  
Timothy J. Ibell, PhD  
*University of Bath, United Kingdom*  
Edward J. Jaselskis, PhD  
*North Carolina State University, United States of America*  
Kiyoshi Kobayashi, PhD  
*Kyoto University, Japan*  
Thomas Kvan, PhD  
*University of Melbourne, Australia*  
Kincho H. Law, PhD  
*Stanford University, United States of America*  
Christopher K. Y. Leung, PhD  
*Hong Kong University of Science and Technology, China*  
Wenkai Liu, PhD  
*North China University of Water Resources and Electric Power, China*  
Campbell R. Middleton, PhD  
*University of Cambridge, United Kingdom*  
Peter W. G. Morris, PhD  
*University College London, United Kingdom*  
George Ofori, PhD  
*National University of Singapore, Singapore*  
Feniosky Pena-Mora, PhD  
*Columbia University, United States of America*  
Qinghua Qin, PhD  
*Australian National University, Australia*  
Klaus Rueckert, PhD  
*Technical University of Berlin, Germany*  
Surendra P. Shah, PhD  
*Northwestern University, United States of America*  
Jinfa Shi, PhD  
*North China University of Water Resources and Electric Power, China*  
Miroslaw Skibniewski, PhD  
*University of Maryland, United States of America*  
Jinbo Song, PhD  
*Dalian University of Technology, China*  
Corrado Lo Storto, PhD  
*University of Naples Federico II, Italy*  
Nobuyoshi Yabuki, PhD  
*Osaka University, Japan*

## General Information

**Aim and Scope:** *International Journal of Architecture, Engineering and Construction* (ISSN 1911-110X [print] and ISSN 1911-1118 [online]), IJAEC, is published by the International Association for Sustainable Development and Management (IASDM) and North China University of Water Resources and Electric Power. IJAEC is a scholarly peer-refereed journal that promotes scientific, technical and managerial advances in the three intertwined disciplines of the built environment: Architecture, Engineering and Construction. IJAEC publishes original research papers, state-of-the-art review papers, novel industrial applications and insightful case studies in a broad scope of topics related to the three disciplines.

**Electronic Manuscript Submission:** Authors can register as a new user, log onto the system and submit manuscripts through the following web link: <http://www.iasdm.org/journals/index.php/ijaec>. Submitting a manuscript to IJAEC for review means that all authors certify that the manuscript is not under review, accepted for publication or published elsewhere and that the copyright for all portions of this manuscript can and will be transferred to IASDM upon acceptance. Written permissions from the original publisher for both print and online reproduction must be provided along with the manuscript if using previously published figures and/or tables. Discussion is welcomed for all materials published in IJAEC and will be considered individually for publication or private response. Detailed instructions to authors can be obtained online through the following web link: <http://www.iasdm.org/journals/index.php/ijaec/about/authors>.

**Length Requirements:** Although there is no strict limit on the maximum number of words or word-equivalent, it is recommended 10,000 for papers and 3,000 for discussions and closures.

**SI Units:** System International (SI) units should be used as the primary units of measure in all submissions.

### Key Ethical Guidelines:

1. The manuscript should present an accurate account of the work performed and an objective discussion of its significance;
2. Data included in the manuscript should be real and authentic and it is unethical to falsify or fabricate data;
3. The work of others contained in the manuscript should be properly acknowledged;
4. Authors should not include citations with the primary purpose of increasing the number of citations to a given author's publication;
5. The authorship should include all and be limited to those who have made significant contributions to the study reported in the manuscript while duly acknowledging others who have participated in certain substantive aspects of the study;
6. The corresponding author should ensure all co-authors have approved the manuscript and agreed to its submission for publication;
7. Authors should acknowledge all funding sources for the study and follow the publishing mandates of the funding agencies, and any substantive conflict of interest that might be interpreted to influence the results should be disclosed;
8. Authors should notify IJAEC as soon as possible if a significant error or inaccuracy is discovered in a published manuscript so that the journal can take prompt remedial actions.

**Copyright** © 2017 by International Journal of Architecture, Engineering and Construction.

This journal and the individual contributions contained in it are protected under copyright. All rights reserved. Apart from any fair dealing for the purposes of research or private study, or criticism or review, no part of this publication may be reproduced, stored or transmitted in any form or by any means electronic, mechanic, photocopying, recording or otherwise, without the prior permission in writing form from the author and the publisher.

**Disclaimer:** Papers and other contributions and statements made or opinions expressed in the journal are published on the understanding that the author of the contribution is solely responsible for the opinions expressed in it and that its publication does not necessarily imply that such statements and/or opinions are or reflect the views of the journal or IASDM.





#### Editorial Office

Hongshan Yuan, PhD, *Director*

Yashuai Li, PhD, *Co-Managing Editor*

Zhuo Feng, PhD, *Co-Managing Editor*

Wenfei Yan, *Editorial Assistant*

Svetlana Besklubova, *Editorial Assistant*

Richard Hannis Ansah, *Editorial Assistant*

#### Production and Distribution

SDM Publishing Limited, Room 1104,  
Crawford House, 70 Queen's Road Central,  
Central, Hong Kong

# International Journal of Architecture, Engineering and Construction

---

Volume 6, Number 3

September 2017

---

#### Research Papers

- 1 Initial Investigations into the Use of Three Heuristic Algorithms to Determine Optimal Intervention Programs for Multiple Railway Objects  
*Daijiro Mizutani, Marcel Burkhalter, Bryan T. Adey, Claudio Martani and Vijay Ramdas*
- 21 Study of the Buffer Tank for the Industrial Waste Water Treatment Plant  
*Malek Jedidi and Salem Mabrouki*
- 35 The Continuous Process and Purposes of the Transformation of Rural Settlements in Bangladesh  
*Masud Ur Rashid*
- 44 Diagnosing Damp in a Tropical Building: Applying Theory to Practice  
*Kofi Agyekum, Joshua Ayarkwa and Burcu Salgin*
- 51 Schedule Delay in Saudi Arabia Road Construction Projects: Size, Estimate, Determinants and Effects  
*Ibrahim Mahamid*
- 59 Analysis of the Major Causes of Poor Quality As-built Records of Underground Utilities  
*Xueqing Zhang and Di Wu*



# Diagnosing Damp in a Tropical Building: Applying Theory to Practice

Kofi Agyekum<sup>1,\*</sup>, Joshua Ayarkwa<sup>2</sup> and Burcu Salgin<sup>3</sup>

<sup>1,2</sup>Kwame Nkrumah University of Science and Technology, Kumasi, Ghana

<sup>3</sup>Department of Architecture, Erciyes University, Melikgazi, Kayseri, Turkey

---

**Abstract:** As the most frequently reported cause of building defects, dampness has for many years received attention worldwide. It is a major problem associated with many buildings, and contributes more than 50% of all known building failures worldwide. In Ghana, dampness is a very common problem among many residential buildings. However, there is no detailed information on the problem, let alone diagnosing it. This paper adopts the principles involved in the diagnosis of damp (visual inspection, investigation using moisture meter, and laboratory assessment) as outlined and accepted internationally, and applies these principles to a real-life scenario in a tropical country like Ghana. A typical six-bedroom residential building is selected and the principles are applied to diagnose the presence of dampness or otherwise. The findings revealed that various forms of dampness existed within the building, including rising damp, penetration damp and plumbing leakages. This study has shown that it is possible to apply the principles of damp investigation to diagnose the presence of dampness or otherwise in buildings located within a tropical region like Ghana.

**Keywords:** Dampness, diagnosis, Ghana, residential buildings, rising damp, salt analysis

**DOI:** <http://dx.doi.org/10.7492/IJAEC.2017.016>

---

## 1 INTRODUCTION

Water is one of the most dangerous enemies of porous building materials. There are many ways in which water penetrates the pores of building materials (Karagiannis et al. 2016). Water in buildings may originate from driving rains, condensation, rain water splash back, capillary rise of water, among others (Karagiannis et al. 2016; Karoglou et al. 2005). According to Karagiannis et al. (2016), there is always some amount of bound water present in building materials. This bound water, if in the right amount, does not affect the durability of such materials in any way. However, where the moisture content of a material exceeds a certain percentage, the deterioration effect of moisture may be triggered, and this may lead to physical, chemical and biological problems in the material (Karagiannis et al. 2016; Moropoulou et al. 2014). It is therefore very important that one gains knowledge in the movement of water within building materials to be able to control some of these problems. Water that is present in a building is called dampness.

Dampness in buildings is a very delicate issue, and if care is not taken, it may be misdiagnosed. Some of the reasons why dampness is often misdiagnosed include the following (Burkinshaw and Parrett 2004): one-off snapshot pre-purchase surveys; solely relying on readings from electrical moisture meters

when such equipment has been designed to detect the absence of moisture; lack of permission from landlords for surveyors to undertake minor puncturing of walls, among others.

Proper diagnosis of dampness in buildings has always been an issue among building surveyors. Adequate information is available, but scattered throughout literature. The work by Burkinshaw and Parrett in 2004 took the understanding of damp diagnosis to a new level. From the work 'diagnosing damp', Burkinshaw and Parrett (2004) demonstrated how inspection of damp problems begins with visual examinations and ends with a more detailed laboratory diagnosis of the problem. Theoretically, there is adequate information on laid down procedures involving a step-by-step approach to the diagnosis of damp problems. However, there is inadequate information available when it comes to the application of the theories to real life scenarios, especially in Africa. This paper therefore adopts the principles involved in the diagnosis of dampness as outlined and accepted internationally, and applies those principles to a real-life scenario (building) in a tropical country like Ghana. A typical case is selected (a six-bedroom residential building), and the principles are applied to diagnose the presence of dampness or otherwise.

The paper is structured into three sections. The first section provides a brief introduction to the study. This section

---

\*Corresponding author. Email: [agyekum.kofi1@gmail.com](mailto:agyekum.kofi1@gmail.com)

is followed by a detailed literature review on the theory behind damp investigations. The final section shows how the principles of damp investigation can be applied to investigate dampness in a typical residential building, and the key findings that were obtained are presented. It is very important for readers to note that the key findings presented are not very detailed. This is because much emphasis was laid on how surveyors within the tropical part of the world, typically Africa and Ghana could apply the principles of damp investigation in a real-life scenario to get results.

## 2 LITERATURE REVIEW

### 2.1 The Theory behind Diagnosing Damp in Buildings

This section of the paper discusses literature on dampness in general. It discusses the general principles of damp investigation and approaches to damp investigation. The section also describes the surveying equipment and tests for conducting such investigations.

#### 2.1.1 Dampness in Buildings

Dampness can be defined as water penetration through the walls and certain elements of a building (Halim et al. 2012). It can also be defined as an excessive quantity of moisture contained in building materials and components which causes adverse movements or deterioration and results in unacceptable internal environmental conditions. Burkinshaw and Parrett (2004) defined dampness as the amount of moisture content present in a material and can be classified as capillary moisture content, equilibrium moisture content, hygroscopic moisture content, total moisture content and potential moisture content. It is the most frequent and main problem in buildings and contributes more than 50% of all known building failures (Halim et al. 2012; Trotman et al. 2004). According to Hollis (2000), dampness is inextricably linked to most building deteriorations. Dampness may be associated with symptoms such as dirty spots on the building, biological growth of plants like the fungi, mosses and creeping plants, paint flaking, blistering, etc. Halim et al. (2012). In order to successfully diagnose and make appropriate recommendations for remedial actions, one should understand dampness and its impact on buildings.

The ultimate objective of any dampness study is to identify the lead source of moisture in order to recommend actions to remedy the problem (Halim et al. 2012). According to Hollis (2000), sources of dampness can be classified as rising damp, penetrating damp, condensation and pipe leakages. Burkinshaw and Parrett (2004) also classified the sources of dampness to include air moisture condensation, penetrating damp, internal plumbing leaks, below ground moisture or building specific sources.

#### 2.1.2 Principles of Dampness Investigation

The most important objective of any dampness study is to identify the lead source of moisture in order to recommend actions to remedy the problem (Halim et al. 2012). During the course of a damp investigation, the sense of sight, touch, taste, smell and hearing as well as communication and analytical skills should be utilized (Burkinshaw and Parrett 2004).

Physical abilities such as climbing ladders, peering under floorboards or squeezing into corners need to be demonstrated by the surveyor (Burkinshaw and Parrett 2004). The investigator needs to be proficient with a range of specialist equipment, like those for conducting tests, or taking samples for testing at a laboratory (Burkinshaw and Parrett 2004).

To deal effectively with the problem of dampness, an organized system of investigative procedures should be undertaken to confirm all the sources of dampness and to ensure that the recommended remedial works are appropriate (Burkinshaw and Parrett 2004). Such a system must begin with the identification and recognition of symptoms or signs associated with dampness. A professional who carries out any form of building inspection should be aware of already existing data. The selection of an effective remedy for any form of dampness must start with a correct diagnosis of the cause (Burkinshaw and Parrett 2004). There are four major stages to any dampness investigation (Figure 1). These are visual investigations, non-destructive testing, destructive testing and laboratory assessment study (Halim et al. 2012; Burkinshaw and Parrett 2004).

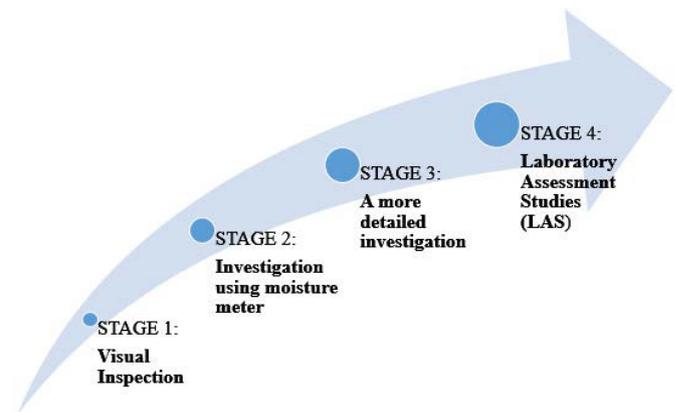


Figure 1. Four stages approach to dampness investigation

A specialist damp investigator will take quite an amount of equipment to site and in most cases, would follow the investigation to whatever stage necessary to identify the cause of a problem (Hamid and Ngah 2010; Burkinshaw and Parrett 2004). In practice, however, surveyors do not firmly stick to these four stages. At times parts of a property exhibit symptoms of a dampness problem for which there is no obvious cause (Burkinshaw and Parrett 2004). When this happens, the investigation may be intensified from stage 2 to stage 3 and sometimes from stage 3 to stage 4 as the surveyor seeks to identify the cause (Hamid and Ngah 2010; Burkinshaw and Parrett 2004). The four stage approach to damp investigation is described in the following sections.

#### Stage 1: Visual Inspection/Investigation

The first stage which is the visual investigation requires the surveyor to inspect the defect closely. It acts as a basis for further investigation and confirmation of the defect assessed (Halim et al. 2012; Burkinshaw and Parrett 2004). This stage is principally based on experience and skill of the personnel involved. The ability to identify any problem of dampness depends on several symptoms such as water stains, cracks, rotten timber, decay, blisters, amongst others. Knowledge

of the behaviour of relevant building materials, construction knowledge and knowledge of the use of the building is very important (Burkinshaw and Parrett 2004). The surveyor needs to record the defect by description, measurement, photograph or sketch drawings. The difficulty associated with this stage is that the surveyor may need to adopt a more scientific approach to diagnosis if the symptoms are complex or conflict with other available information (Halim et al. 2012; Burkinshaw and Parrett 2004).

#### *Stage 2: Non-destructive Testing*

During the stage 2 investigation, the moisture meter is the most widely used instrument for the diagnosis of dampness in buildings (Halim et al. 2012). The moisture meter is used to inspect materials or elements of construction in place without causing modifications, damages or destruction to the fabric of the building (Halim et al. 2012; Burkinshaw and Parrett 2004). In a stage 2 investigation, the surveyor is advised to establish an efficient work pattern. This speeds up surveying and reduces the risk of missing potential problems (Burkinshaw and Parrett 2004). No walls or surfaces should be ignored, but it is sensible to spend more time in the likely damp zones that the visual inspection has highlighted. Readings should be taken around external openings or where potential penetrating damp positions have been noted (Burkinshaw and Parrett 2004).

#### *Stage 3: Destructive Testing*

The destructive testing stage offers a specific set of measurements or data in response to a known or suspected dampness conditions (Halim et al. 2012; Burkinshaw and Parrett 2004). This assessment requires the assembly of techniques that may be used to inspect or observe materials or elements of construction in place. It also involves causing modifications, damages or destruction to the fabric of the building. The tools and techniques used at this stage include drilling of samples (mortar, bricks/blocks), salt test, carbide meter, electronic-thermo hygrometer and mechanical hygrometer (Halim et al. 2012; Burkinshaw and Parrett 2004). Oven drying method which is the most precise method of determining the moisture content of materials involves taking samples, weighing the samples and drying the samples to constant weight in an oven at a suitable temperature (100°C) and then re-weighing. Dampness is expressed by the weight loss achieved through drying as a percentage of the oven dry weight of the material being examined (Halim et al. 2012; Trotman 2007; Burkinshaw and Parrett 2004).

#### *Stage 4: Laboratory Assessment Study*

The final stage may apply to a whole building or to the further investigation of a damp zone identified from a Stage 2 or 3 investigation (Halim et al. 2012; Burkinshaw and Parrett 2004). A stage 4 investigation is usually carried out in the context of a specialist dampness investigation and the surveyor spends a lot of time to concentrate on dampness issues. The thinking process will be aimed at diagnosing the problem of dampness. Several equipment is required to carry out the investigation at this stage (Halim et al. 2012; Burkinshaw and Parrett 2004). During this stage, destructive tests and examinations that require opening up are conducted. More

emphasis is placed on the sampling which aims at confirming moisture conditions within structural elements by drilling out masonry samples (Burkinshaw and Parrett 2004). The decision on where samples should be drilled depends on the purpose of the investigation conducted and prevailing site conditions (Burkinshaw and Parrett 2004). A typical investigation could first involve sampling at various positions laterally to confirm a damp zone, then by vertical sampling where damp patches extend upwards. A typical stage 4 investigation of an average-sized house with very average moisture conditions could involve drilling 10-12 holes (Burkinshaw and Parrett 2004).

#### *2.1.3 Surveying Equipment and Tests for Dampness Investigation*

As a leading cause of building deterioration, high moisture levels can cause decay, warping or corrosion of materials (Halim et al. 2012; Ahmad and Abdul Rahman 2010; Riley and Cotgrave 2005). High humidity may result in mould, mildew or staining, and paint may peel or blister as a result of too much moisture (Halim et al. 2012; Ahmad and Abdul Rahman 2010; Riley and Cotgrave 2005). Although moisture problems are so persuasive and detrimental, there are limited understanding of the causes and conditions leading to the various problems. To critically investigate and analyse the causes of such problems, various instruments and methods can be used. These methods and instruments include the following:

##### *Determination of the Moisture Content of Materials*

The moisture content of a material is the ratio of the mass of moisture within a given volume to the dry mass of the same volume, multiplied by 100 percent (Trotman 2007). Moisture content can also be expressed as a volume fraction, which is the volume of moisture contained within a volume of dry material, in which case the density of the material must be known to convert it to a mass percentage.

According to Sandrolini and Franzoni (2006), the first step to identifying the actual source of moisture in damp buildings is to measure the moisture content. There are wide ranges of techniques either destructive or non-destructive and direct or indirect for investigating moisture contents in buildings (Sandrolini and Franzoni 2006). The indirect methods of measuring dampness in buildings include the infra-red thermography and moisture meters (Electrical resistance meters, electrical capacitance meters, Radar and microwave techniques, Neutron scattering techniques).

##### *Drilling for Samples in Masonry Walls*

It is necessary to use sampling or meters to determine the source of any dampness in buildings (Trotman 2007). According to Burkinshaw and Parrett (2004) sampling is the extraction of masonry materials (bricks, blocks, mortar, plaster, etc.) from or within a wall, usually by cold drilling (to between 10 mm and 80 mm depth). The basis for the drilling method is to drill out damp masonry or mortar and measure moisture content and hygroscopic moisture content.

Walls may contain considerable quantities of hygroscopic salts. As a result of that hygroscopicity should be measured to see whether the walls could have absorbed the quantity of water found in the samples from the atmosphere. On site


moisture content can be established by using a carbide meter, a commercial piece of equipment where the damp drillings and carbide are mixed in a pressure vessel (Trotman 2007; Trotman et al. 2004; Burkinshaw and Parrett 2004). A gauge measures the pressure generated and the calibration is directly related to the moisture content. If several samples are taken, it is more convenient to test in the laboratory to establish both moisture content and hygroscopic moisture content (Trotman et al. 2004).

Samples can be collected through the entire depth of a masonry wall. Trotman et al. (2004) noted that “in particularly thick walls, drilling at 25 mm or 50 mm increments can create a moisture content profile through the depth of the wall. Drilling is stopped 5-10 mm short of the inner face of each leaf to prevent penetrating the cavity and losing the dust sample”. This staged drilling technique can be achieved by marking along the length of the drill or by using a depth gauge attachment (Trotman et al. 2004).

The main disadvantage of the drilling method is that it is semi-destructive, and requires at least a series of 9 mm holes, or if the wall is plastered, a chase cut out to locate the mortar joints. In practice, building owners are usually content for samples to be taken so that a definitive diagnosis can be made (Trotman et al. 2004; Burkinshaw and Parrett 2004).

Among the equipment needed to drill the samples are: electric drill (hammer-action, variable speed)-corded with extension lead, or cordless with spare batteries/charger; sharp tungsten carbide drill bits, 6, 10 and 16 mm diameter and of suitable length; containers for samples (eg. 35 mm camera film cases) with self-adhesive labels; plastic resealable sample bags; dustpan/brush/cleaning equipment; metal detector; sharp 65 mm bolster, claw hammer; small piece of card for collecting dust; carbide meter, with fresh powder; small piece of hardboard to collect debris and facilities clearing up; making good materials (if required); safety equipment-goggles, gloves, face mask, etc. (Hamid and Ngah 2010; Burkinshaw and Parrett 2004; Trotman et al. 2004).

Figure 2 shows typical drilling patterns that can be used in the collection of samples from brick masonry. There are three routes through which ground water can travel to enter the wall. The invasion as shown in Figure 2 will follow the shortest route (A) or (B) when the material is more absorbent than the mortar; it may also follow the longest route (C) and makes little progress when the material does not allow capillary action (Massari and Massari 1993).

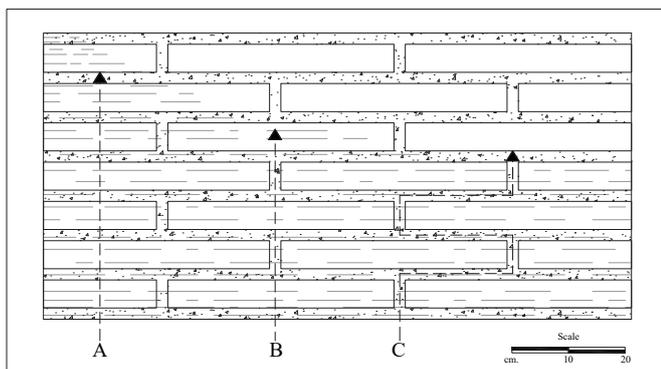

**Figure 2.** Possible routes of moisture in a masonry wall (Massari and Massari 1993)

According to Trotman et al. (2004), the drilling technique is generally used on masonry materials such as brick, stone, concrete, block work walling, etc. It is better to drill into the mortar because the bricks /blocks will have lower moisture content (Trotman et al. 2004).

Also, the drilling of mortar samples is important because they are the dominant paths through which damp rises in walls of buildings (Rirsch and Zhang 2010). It is always advisable to collect the samples in a stoppage bottle for subsequent laboratory tests (Trotman et al. 2004).

### 3 RESEARCH METHODOLOGY

With permission from the building owner, the study adopted a holistic approach to dampness surveying, and involved the four-stage protocol of damp investigation to diagnose dampness in the building. The investigation consisted of a single case study of the building (a six-bedroom residential apartment) reported to be experiencing severe dampness problems. Literature reports that in an invasive inspection, more can be learned about damp damage in one inspection than in a hundred more cursory surveys (Burkinshaw 2012).

The four main approaches to damp investigation include visual inspections, investigations using moisture meters (i.e. non-destructive tests), a more detailed investigation (i.e. destructive tests) and homing in on the problem (i.e. laboratory assessment study) (Halim et al. 2012; Burkinshaw and Parrett 2004). The methods applied to diagnose the dampness in the building is discussed under the various approaches.

#### 3.1 Stage 1: Visual Inspection

The visual inspection was conducted through the observation of the surrounding area, checking of the damp zones and physically identifying the causes of the dampness based on the symptoms identified from the building. Furthermore, examinations of the exteriors of the building from street level and from higher access (roofing, rain water gutters, etc.) were carried out for any obvious defects. Also, the interior parts of the building were examined to determine areas affected by dampness. Figure 3 shows some of the damp affected areas identified from the visual inspection.



**Figure 3.** Some of the affected areas of the building identified during the visual inspection

#### 3.2 Stage 2: Investigation Using Moisture Meter (Non-destructive Testing)

The non-destructive testing on the building was carried out to identify the problematic areas. Moisture content measurements were taken on the walls of the building which showed symptoms such as blistering of paints, peeling of paints, staining, mould growth, etc. Grids of 300 mm × 300 mm were

drawn on the surfaces of affected walls and moisture contents were recorded.

The PCE-MMK1 universal moisture meter was used to measure moisture contents in the sandcrete block walls of the building. This is a multi-functional equipment that can read moisture content, temperature and the relative humidity of the affected walls. Checklists were prepared to record readings. The readings were important in identifying areas within the wall zones where the problem was very severe for further investigation to be conducted.

For the PCE-MMK1 universal moisture meter, maximum moisture content and relative humidity for masonry materials like cement mortar are recorded at 3.0% and 100% respectively. Moisture content and relative humidity readings were interpreted (Halim and Halim 2010) as:

The wall is considered a very wet zone where the moisture contents recorded are greater than 2.8% and the relative humidity ranges between 22% rH and 100% rH; A moist condition is recorded where the moisture content ranges between 1.5% -2.8% and the relative humidity lies between 18% rH-21% rH; and a dry condition or level of dampness is recorded where the moisture content is less than 1.5% with relative humidity ranging between 6% rH and 18% rH (Agyekum et al. 2014).

For the building under study, since the walls in all orientations had been affected by dampness, grids of 300 mm×300 mm were drawn on all the walls using a tape measure and light wooden batten. On the faces of the suspected damp walls, a tape measure was laid along the walls and at right angles to this, a light wooden batten was used to mark some values. These markings created grids against which moisture meter readings could be plotted. Damp walls in the various orientations extended from about 600 mm to 900 mm depending on how high the water had risen. Figure 4 shows the procedures that were followed to measure the moisture contents for the gridlines to be drawn.



**Figure 4.** Measuring and drawing the grids using the tape measure and light wooden batten

### 3.3 Stages 3 and 4: Destructive Testing and Laboratory Assessment

The stage 2 investigations enabled the problematic areas to be identified, leading to the stages 3 and 4 investigations. The stages 3 and 4 approaches used in this study involved destructively sampling mortar from the problematic areas by adopting approaches used in previous studies (Burkinshaw 2012; Ahmad and Abdul Rahman 2010; Hamid and Ngah 2010; Burkinshaw and Parrett 2004). These samples were sent to the laboratory for further investigations to be conducted. Primary data were obtained from laboratory tests conducted on the mortar samples.

#### 3.3.1 Sampling of Mortar from the Building

The walls of the building were constructed using sandcrete blocks. The sandcrete blocks were bonded together with 150 mm thick mortar. Mortar samples were collected because studies have confirmed that mortar is the dominant path through which damp rises in walls of buildings (Burkinshaw 2012; Rirsch and Zhang 2010). The mortar samples were obtained from the building by using a similar pattern (Pattern B) as presented in Figure 2. Figure 5 as presented below shows how the mortar samples were collected from the walls and placed in the 35 mm camera film cases.



**Figure 5.** Mortar sampled and placed in 35 mm camera film cases

The equipment and materials used to obtain the mortar samples from the building included cordless drills, sharp tungsten carbide drill bits, 35 mm camera film cases for holding samples, plastic resealable sample bags, sharp 65 mm bolster, small piece of card for collecting dust, PCE MMK1 universal moisture meter with deep probes, rule, note pad and labels.

Three different types of mortar samples were taken at 300 mm height intervals up to the height of visible damp (i.e 300 mm, 600 mm, 900 mm) to provide information about water soluble salts distributions in the walls (Burkinshaw and Parrett 2004). An extra sample was collected about 1.5 m above the height of visible damp to act as a control. In all, twelve (12) different samples of mortar (including control samples), three at each height were drilled at depths of 0 – 25 mm, 25 – 50 mm and 50 – 75 mm into the affected walls of the building.

#### 3.3.2 Analyzing the Moisture and Salt Contents of the Mortar Samples

Samples of mortar from the building were sent to the Geotechnical Laboratory at the Building and Road Research Institute (BRRI) of the Council for Scientific and Industrial Research (CSIR), Kumasi, Ghana, where tests were conducted in accordance with BS BS 1377 (1990). Laboratory tests conducted on the mortar samples included the moisture content test (BS 1377 1990). The moisture content (*MC*) was determined by the oven-dry method. The amount of moisture in the samples was determined and expressed as a percentage of its dry mass. The moisture content was determined by taking about 50 grams each of the soil and mortar into moisture cans and the masses were measured (*M*<sub>1</sub>). The samples were then oven dried and measured again (*M*<sub>2</sub>). The moisture content was determined as follows (1):

$$MC = \frac{M_1 - M_2}{M_2} \times 100\% \quad (1)$$

Samples of the mortar were further sent to the Chemical Laboratory of the Department of Chemistry at the Kwame Nkrumah University of Science and Technology (KNUST), Kumasi, Ghana, for chemical tests. The chemical tests performed on the mortar samples were carried out in accordance

with BS 4551 (2005).

Equipment used in the analysis of the salt included Ion Chromatography (Metrohm 861 Advanced Compact IC), mechanical shaker, 100 ml measuring cylinder, satorious extend analytical balance, centrifuge tubes (15 ml and 50 ml), wash bottles and volumetric flasks (2000 ml, 1000 ml, 100 ml) (Seubert et al. 2002; American Standard for Testing Materials 2011; American Standard for Testing Materials 2009).

## 4 FINDINGS AND DISCUSSION

Key findings from the principles used in the study are presented under the various stages to include the following:

### 4.1 Stage 1: Visual Investigation

The investigation revealed that there were combinations of several sources of dampness. These included plumbing leakages, rising dampness, condensation, among others. This stage further revealed that dampness in the walls of the building was associated with symptoms such as cracks in walls, blistering of paint, flaking of plaster, surface efflorescence and stains on the walls. Symptoms such as surface efflorescence, damp base of walls up to 1.5 m in horizontal band, among others, closely related to rising dampness were identified.

### 4.2 Stage 2: Non-destructive Investigation

The non-destructive tests conducted with the Universal moisture meter identified the dampness to be pronounced in both the external and internal walls oriented in the western direction. Plumbing leakages were identified in the bathrooms located within this orientation, and could have contributed to the severity of the dampness. Furthermore, dampness was pronounced in the internal walls of bedroom 1 (located in the western orientation) than the other bedrooms. All the destructive tests conducted in the bathrooms located within the building revealed that dampness in most of the internal walls were due to plumbing leakages. However, on the exterior walls of the buildings, rising dampness was very predominant.

### 4.3 Stages 3 and 4: Destructive Testing and Laboratory Assessment

Further analysis from the Stages 3 and 4 investigations revealed that the main salts that were predominant in the mortar samples from the building were magnesium sulphate ( $MgSO_4$ ), magnesium chloride ( $MgCl_2$ ), sodium sulphate ( $Na_2SO_4$ ) and sodium chloride ( $NaCl$ ). The results further revealed that although all these salts identified in the study could be damaging,  $Na_2SO_4$ ,  $MgSO_4$  and  $MgCl_2$  are more destructive and can result in more extensive decay in the walls of the building studied (Lopez Arce et al. 2009; De Clercq 2008; Young 2008; Zsembery 2001).

## 5 CONCLUSION

Dampness is most frequently reported as the main cause of building defects around the world. If residential properties are to be carefully surveyed regularly, many problems will

be identified before they become very severe. Unfortunately, most houses are often inspected by construction professionals when the problem has become sufficiently advanced to be noticed by the occupier. This paper sought to adopt the principles involved in the diagnosis of damp as outlined and accepted internationally, and applies those principles to a real-life scenario in a tropical country like Ghana. A typical case was selected (a six-bedroom residential building), and the principles were applied to diagnose the presence of dampness or otherwise in the building. The study revealed that various forms of dampness existed within the building. The forms included rising damp, penetration damp and plumbing leakages. The study further revealed that although all the various forms were present, rising damp was the most predominant. This form of dampness was also associated with dangerous salts such as  $Na_2SO_4$ ,  $MgSO_4$  and  $MgCl_2$ . Diagnosing the true cause of dampness plays a significant role in providing lasting solutions to the problem. The lessons from this study supersede the case presented. The study has shown that it is possible to apply the four-stage approach to damp investigation to accurately diagnose damp in a typical tropical building. This study does not only present theories behind dampness and its causes, it offers detailed and practical advices on how to effectively investigate and report on dampness issues using modern equipment and gadgets.

## REFERENCES

- Agyekum, K., Ayarkwa, J., and Koranteng, C. (2014). "Holistic diagnosis of rising damp and salt attack in two residential buildings in Kumasi, Ghana." *Journal of Construction Engineering*, 1, 1-13.
- Ahmad, A.G., and Abdul Rahman, H.F. (2010). "Treatment of salt attack and rising damp in heritage buildings in Penang, Malaysia." *Journal of Construction in Developing Countries*, 15 (1), 93-112.
- American Standard for Testing Materials (2011). "The determination of inorganic anions in water by suppressed ion chromatography". West Conshohocken, United States.
- American Standard for Testing Materials (2009). "Standard test method for determination of dissolved alkali and alkaline earth cations and ammonium in water and waste water by ion chromatography". West Conshohocken, United States.
- British Standard Code (2005). "Mortar- Methods of test for mortar and screed-Chemical analysis and physical testing". London, United Kingdom.
- British Standard Code (1990). "Methods of tests for soils for civil engineering purposes". London, United Kingdom.
- Burkinshaw, R. (2012). "Rising damp: Part 1, case study examples and the Lambeth Pier Test: How to isolate ground-sourced rising damp by the 'Burkinshaw Test Method'." *Journal of Building Survey, Appraisal and Valuation*, 1 (1), 1-15.
- Burkinshaw, R., and Parrett, M. (2004). *Diagnosing Damp*. RICS Books, Coventry, UK.
- De Clercq, H. (2008). "The effect of other salts on the crystallization damage to stone caused by sodium sulphate." *4th International Conference on Salt Weathering of Buildings*

- and *Stone Sculptures*, Copenhagen, Denmark.
- Halim, A.A., and Halim, A.Z. (2010). "An analysis of dampness study on heritage buildings: A case study Ipoh Old Post Office Building and Suluh Budiman Building, UPSI, Perak, Malaysia." *Journal of Sustainable Development*, 3, 171-182.
- Halim, A.A., Harun, S.N., and Hamid, Y. (2012). "Diagnosis of dampness in conservation of historic buildings." *Journal Design + Built*, 5 (1), 1-14.
- Hamid, Y., and Ngah, S. (2010). "Assessment of dampness problems in the higher education institution building." *12th International Surveyor's Congress (Reaching 50 and Surveying Ahead)*, Kuala Lumpur, Malaysia.
- Hollis, M. (2000). *Surveying Building*. RICS Books, Coventry, UK.
- Karagiannis, N., Karoglou, M., Bakolas, A., and Moropoulou, A. (2016). "Building materials capillary rise coefficient: Concepts, determination and parameters involved." *Building Pathology and Rehabilitation*, 6, 27-44.
- Karoglou, M., Moropoulou, A., Giakoumaki, A., and Krokida, M.K. (2005). "Capillary rise kinetics of some building materials." *Journal of Colloid Interface*, 284, 260-264.
- Lopez-Arce, P., Doehne, E., Greenshields, J. Benavente, D., and Young, D. (2009). "Treatment of rising damp and salt decay: The historic masonry buildings of Adelaide, South Australia." *Materials and Structures*, 42(6), 827-848.
- Massari, G., and Massari, I. (1993). *Damp Buildings, Old and New*. ICCROM, Rome, Italy.
- Moropoulou A., Karoglou M., Bakolas A., Krokida M. and Maroulis Z. B. (2014). "Moisture transfer kinetics building materials and components: Modeling, experimental data, simulation". In Delgado, J. M. (Ed.), *Drying and Wetting of Building Materials and Components*, 27-49. Springer, Berlin, Germany.
- Riley, M. and Cotgrave, A. (2005). "Dampness in buildings: Division of sustainable development." Available at: <<http://folders.nottingham.edu.cn/>>.
- Rirsch, E. and Zhang, Z. (2010). "Rising damp in masonry walls and the importance of mortar properties." *Construction and Building Materials*, 24, 1815-1820.
- Sandrolini, F., and Franzoni, E. (2006). "An operative protocol for reliable measurements of moisture in porous materials of ancient buildings." *Build Environment*, 41, 1372-80.
- Seubert, A., Frenzel, W., Schäfer, H., Bogenschütz, G. and Schäfer, J. (2002). "Sample preparation techniques for ion chromatography". In Michalski, R. (Ed.), *Application of IC-MS and IC-ICP-MS in Environmental Research*. John Wiley & Sons, New York, United States.
- Trotman, P. (2007). *Rising Damp in Walls: Diagnosis and Treatment*. BRE Group, Berkshire, United Kingdom.
- Trotman, P., Sanders, C., and Harrison, H. (2004). *Understanding Dampness*. BRE Group, Berkshire, United Kingdom.
- Young, D. (2008). "Salt attack and rising damp: A guide to salt damp in historic and older buildings". Heritage Council of New South Wales, Sydney, Australia.
- Zsembery, S. (2001). "Manual 2: The properties of clay masonry units". Think Brick Australia, Sydney, Australia.



[www.iasdm.org](http://www.iasdm.org)

International Association for  
Sustainable Development and Management

